




SL0021 SMARTlift Top Arm Angle Sensor Cable Service

Date: 18 Oct 07	Author: Richard Brown	SMARTlift	Version 1
-----------------	-----------------------	-----------	-----------

At next service please add 12mm Spiralflex to the Top Arm Angle Sensor Cable to prevent the cable from becoming trapped and crushed between the Top Arm Cylinder Rod Eye and the inside of the Top Arm Fabrication.

The symptom of a possible crushed angle sensor cable will be a blown Angle Sensor Ground 2A fuse in the module junction box. This may cause other Angle Sensors Errors to be displayed too.

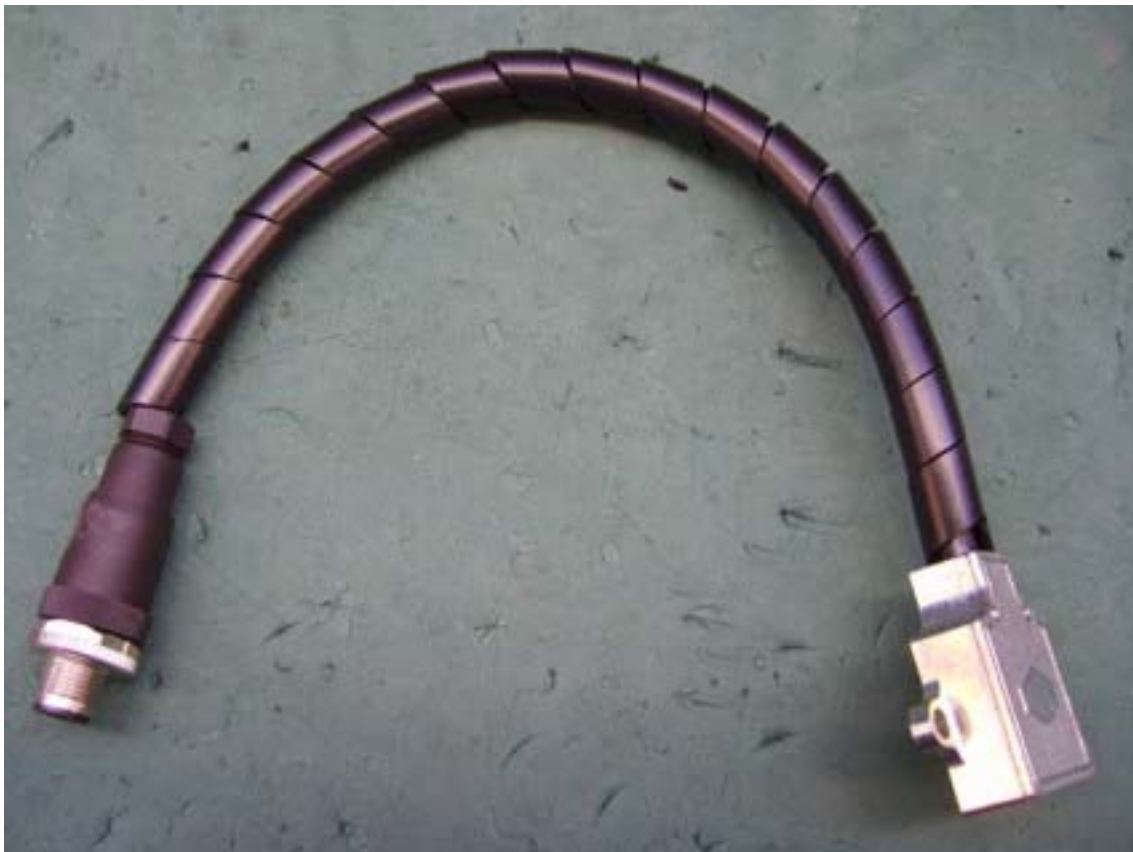

Cable shown with 12mm Spiralflex added.