

SL0013 Faulty Terminal Jumper


SL0013	Version 1	SMART <i>lift</i>	22 Sept 06
--------	-----------	-------------------	------------

This service info applies to all Digital Control and Smartlift trailers.

These two jumpers are essential to Can Bus operation, they are located in the rear junction box which contains the LCD screen.



The jumper is manufactured from two separate pieces. The metal insert is simply pushed into the plastic housing.

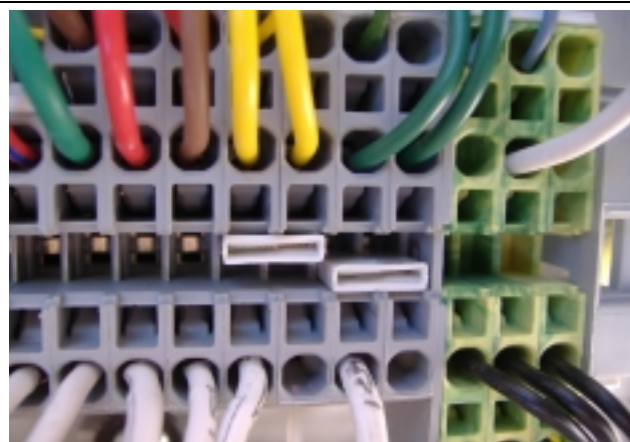

On one occasion the metal insert has pushed up in the plastic housing when the jumper was inserted to the wago block, causing a very poor connection.

Make sure that the metal insert is pushed fully down when fitting the jumper. The insert should be about 4mm inside the plastic outer.